HS-423 Accelerometer

4-20mA acceleration and AC acceleration output via Braided Cable




Unique dual output

- For use with PLC/DCS systems
- and data collectorsCustomisable features

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



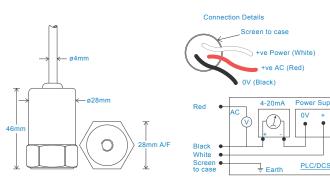

Technical Performance

Mounted Base Resonance10kHz minAcceleration Rangessee: 'How To Order' table ±10%
Nominal 80Hz at 22°CFrequency Response10Hz (600cpm) to 5kHz (300kcpm) ± 5%
- ISO10816IsolationBase isolated
RangeRangesee: 'How To Order' table
Transverse Sensitivity

| Case Material | Stainless Steel |
|------------------------------|---|
| Sensing Element/Construction | PZT/Compression |
| Mounting Torque | 8Nm |
| Weight | 135gms (nominal) |
| Maximum Cable Length | 1000 metres |
| Standard Cable Length | 5 metres |
| Screened Cable | Braided - length to be specified with order |
| Mounting Threads | see: 'How To Order' table |
| | |

Electrical

| Current Output | 4-20mA DC current proportional to |
|------------------|---|
| | acceleration and AC acceleration |
| Bias Voltage | 3 Volts DC (nominal) |
| Supply Voltage | 15-30 Volts DC (for 4-20mA) |
| Settling Time | 2 seconds |
| Output Impedance | Loop Resistance 600 Ohms max. at 24 Volts |
| Case Isolation | >10 ⁸ Ohms at 500 Volts |


Environmental

Mechanical

Operating Temperature Range Sealing Maximum Shock EMC

| -25 to 90°C |
|----------------|
| IP65 |
| 5000g |
| EN61326-1:2013 |

Typical Frequency Response

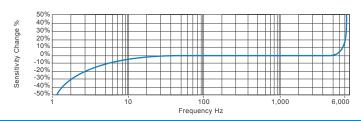


Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



How To Order

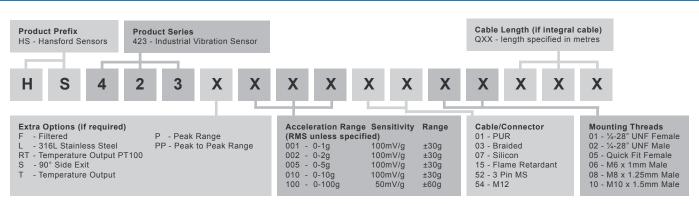



www.hansfordsensors.com sales@hansfordsensors.com



We reserve the right to alter the specification of this product without prior notice TS106.5