# **HS-160S Accelerometer**

AC velocity output via Silicon Cable


## **Key Features**

- Waterproof
- · AC velocity output
- · Side entry for easy access

#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



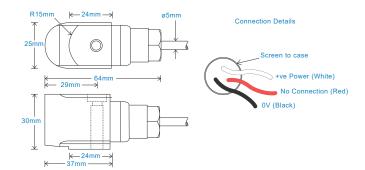

### **Technical Performance**

 Mounted Base Resonance
 see 'How To Order' table (nominal)

 Sensitivity
 see: 'How To Order' table ±10%

 Nominal 80Hz at 22°C

 Frequency Response
 3Hz (180cpm) to 4.5kHz (270kcpm) ± 10%

 2Hz (120cpm) to 6kHz (360kcpm) ± 3dB

 Isolation
 Base isolated

 Range
 see: 'How To Order' table

 Transverse Sensitivity
 Less than 5%

#### Mechanical

Case Material Stainless Steel Sensing Element/Construction PZT/Compression Mounting Torque Mounting Bolt Provided see: 'How To Order' table x 30mm long 185gms (nominal) body only Maximum Cable Length 1000 metres Standard Cable Length 5 metres Screened Cable Silicon - length to be specified with order Mounting Threads see: 'How To Order' table Submersible Depth 100 metres max (10 bar)

### Electrical

 Excitation Voltage
 18-30 Volts DC

 Electrical Noise
 0.1mg max

 Current Range
 0.5mA to 8mA

 Bias Voltage
 10 - 12 Volts DC

 Settling Time
 2 seconds

 Output Impedance
 200 Ohms max

 Case Isolation
 >108 Ohms at 500 Volts

# Environmental


 Operating Temperature Range
 -50 to 140°C

 Sealing
 IP68

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013

# Typical Frequency Response

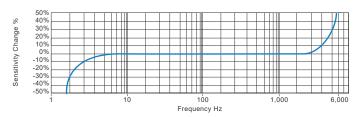


## **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



## How To Order

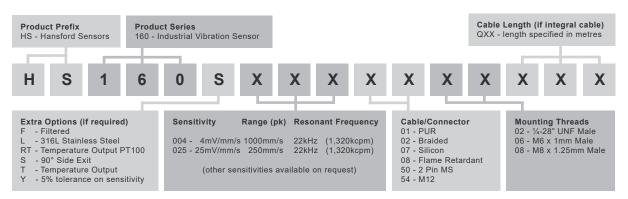



www.hansfordsensors.com sales@hansfordsensors.com

